


Continental Remediation LLC

Move the Solution, Not the Problem

Completed Project-Home Heating Oil Remediation - Ringwood, New Jersey

Contamination extended to 19' below surface as well as under deck and residence. Groundwater was approximately 6' below surface. Down gradient MW-3 displayed Tetrachloroethene above standards. This area was included in the treatment and removed all traces of the chlorinated compounds. Injections were performed on 6/27/07 and the first groundwater samples taken on 7/31/07. Only one compound was marginally over the NJDEP standards. All were below by 9/27/07.

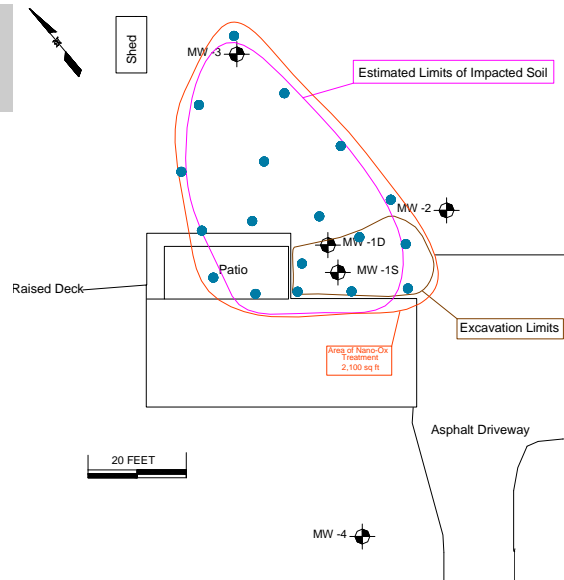

Groundwater Analytical Summary Ringwood New Jersey

CLIENT ID:	MW-4			MW-3			MW-2			MW-1D			MW-1S			NJG-New (ug/L)
	COLLECT DATE:	11/3/06	7/31/07	9/27/07	11/3/06	7/31/07	9/27/07	11/3/06	7/31/07	9/27/07	11/3/06	7/31/07	9/27/07	11/3/06	7/31/07	
Contaminate	Result	RL		Result	RL		Result	RL		Result	RL		Result	RL		
:TotalVolatileTic	5.1	ND	ND	44.9	ND	ND	ND	ND	ND	144.3	187.9	301	352	ND	3.4	
Carbon disulfide	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	9.5	ND	ND	ND	700
Ethylbenzene	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	1.6	1.8	ND	ND	ND	700
m&p-Xylenes	ND	ND	ND	ND	ND	ND	ND	ND	ND	1.5	ND	ND	1.1	ND	ND	1000
Methylene chloride	1.7	ND	ND	1.4	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	3
o-Xylene	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	1.6	ND	ND	1000
Tetrachloroethene	ND	ND	ND	1.1	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	1
Toluene	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	1.5	ND	ND	1000
:TotalSemiVolatileTic	153.2	ND	ND	440.6	18	ND	176	ND	9.6	275	17.2	227.4	1,196	189.9	77.8	
2-Methylnaphthalene	ND	ND	ND	ND	ND	ND	ND	ND	ND	13	ND	ND	43	8.8	ND	NA
Acenaphthene	ND	ND	ND	ND	ND	ND	ND	ND	ND	3.3	ND	6.1	11	4	ND	400
Acenaphthylene	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	1.1	ND	ND	NA
Anthracene	ND	ND	ND	ND	ND	ND	ND	ND	ND	0.9	ND	ND	5.5	ND	ND	2000
Bis(2-Ethylhexyl)phthalate	4.1	ND	ND	2.7	ND	ND	1	ND	ND	9.8	ND	ND	5.8	1.3	ND	3
Carbazole	2.1	ND	ND	ND	ND	ND	ND	ND	ND	3.6	ND	1.6	ND	ND	ND	NA
Dibenzofuran	3.2	ND	ND	ND	ND	ND	ND	ND	ND	4.2	ND	ND	5	ND	ND	NA
Fluoranthene	ND	ND	ND	ND	ND	ND	ND	ND	ND	0.59	ND	ND	1.3	ND	ND	300
Fluorene	4.4	ND	ND	ND	ND	ND	ND	ND	ND	8	ND	7.6	14	3.5	ND	300
Naphthalene	ND	ND	ND	ND	ND	ND	ND	ND	ND	4.6	ND	ND	6.2	ND	ND	300
Phenanthrene	4.2	ND	ND	ND	ND	ND	ND	ND	ND	9.3	ND	6.8	31	1.9	ND	NA
Pyrene	ND	ND	ND	ND	ND	ND	ND	ND	ND	0.7	ND	ND	4.7	ND	ND	200
Benzo[a]Anthracene	ND	0.061	0.031	ND	ND	0.031	ND	0.056	0.051	ND	ND	0.051	ND	0.14	0.082	0.1
Benzo[a]Pyrene	ND	0.02	ND	0.03	ND	ND	0.04	0.022	ND	0.069	ND	ND	0.033	0.022	0.02	0.1
Benzo[b]Fluoranthene	0.03	0.03	ND	0.06	ND	ND	0.09	0.033	0.031	0.13	ND	ND	0.044	0.033	0.041	0.2
Benzo[k]Fluoranthene	ND	ND	ND	0.03	ND	ND	0.03	ND	ND	0.04	ND	ND	ND	ND	ND	0.5
Dibenzo[a,h]Anthracene	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	0.3
Hexachlorobenzene	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	ND	0.02
Indeno[1,2,3-cd]Pyrene	ND	ND	ND	ND	ND	ND	0.03	ND	ND	0.034	ND	ND	ND	ND	ND	0.2

Only compounds that were detected on any sampling round are reported above.

Phone: 800-425-7900
 Fax: 781-644-6070
 Email: Info@continentalremediation.com
 184 Riverview Avenue 2nd FL
 Waltham, MA 02453-3843

