



Continental Remediation LLC


Move the Solution, Not the Problem

Completed Project-Home Heating Oil Remediation - Marlboro, New Jersey



Contamination was from a 290 gallon heating oil Above Ground Storage Tank. Extent of contamination was determined by hand auger soil borings and Geo-Probe soil sampling. Contaminated samples displayed a continuous sheen of hydrocarbon when placed in clean water. A single application of Molecular Oxidation Material was successful in reducing the soil contamination below NJDEP standards @ 6 weeks.

Contamination was shallow, with groundwater 2 to 3 feet below ground surface. A gradual flooding through multiple points prevented breakthrough to the surface, eliminated any chance for odors and was completely safe to be used beneath the bedrooms of the residential children, a prime consideration of the parents. Project was completed within 4 hours.

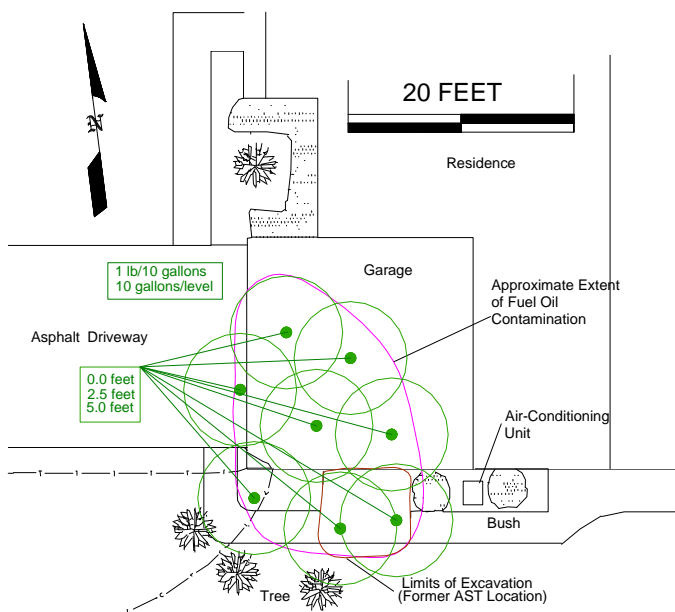

MARLBORO RESIDENCE POST REMEDIATION ANALYTICAL RESULTS

ANALYTICAL RESULTS FOR SOIL SAMPLES

Client ID:	S-12	S-2	S-3	S-4	S-5	S-6	S-7	S-8
Depth	2'	4'	6'	1'	5'	1'	3'	5'
Date Sampled	11/28/06	11/28/06	11/28/06	12/28/06	12/28/06	12/28/06	12/28/06	12/28/06
TRPH mg/Kg	510	400	ND	93	ND	ND	ND	2,000
Volatile Organics in soil over 1,000 ppm								
TIC's	Not tested							18

ANALYTICAL RESULTS FOR GROUNDWATER SAMPLES

Client ID:	MW-1	MW-2	MW-3	MW-4	Blank		
Depth	2.29'	2.2'	2.79'	2.81'			
Date Sampled	12/28/06	12/28/06	12/28/06	12/28/06	12/28/06		
Chloroform	17		18	4.5			
MTBE			16				
TIC's	ND	ND	86.4	ND	ND		

All soil sample results were below NJDEP standards on the first round of soil samples @ 6 weeks. Groundwater was below standards @ 10 weeks.

184 Riverview Avenue 2nd FL
Waltham, MA 02453-3843

Phone: 800-425-7900

Fax: 781-644-6070

Email: Info@continentalremediation.com



**CONTINENTAL
REMEDICATION LLC**