





# Continental Remediation LLC

Move the Solution, Not the Problem

## Completed Project-Home Heating Oil Remediation - Parsippany, New Jersey

Under house angular injection and vertical injection around residence to complete extensive excavation cleanup.

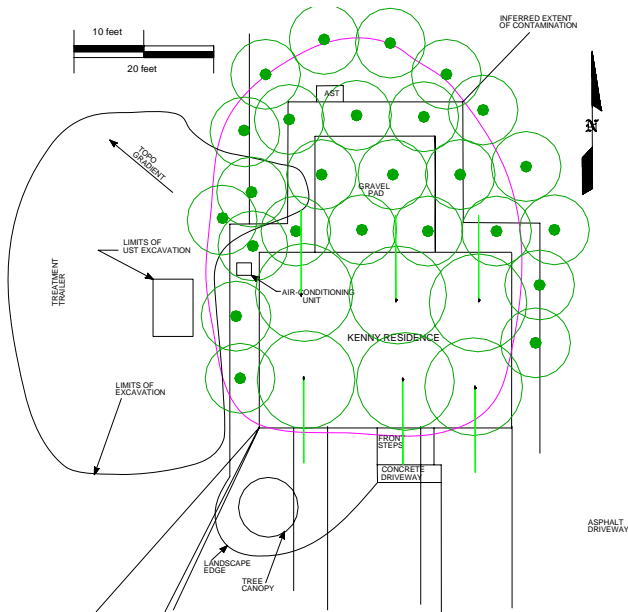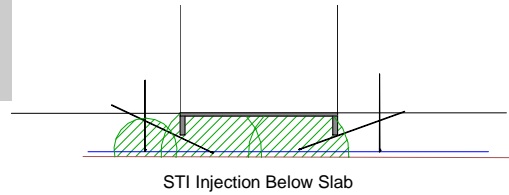

ANALYTICAL RESULTS FOR SOIL SAMPLES										
Client ID:	S-3	S-4	S-5	S-6	S-7	S-8	S-9	S-10	S-11	Average
Depth	7-7.5'	8-8.5'	6.5-7'	7-8'	7.5-8'	7-7.5'	4.5-5.5'	7-8'	7.5-8'	
Date Sampled	4/7/06	4/7/06	4/7/06	4/7/06	4/7/06	4/7/06	4/7/06	4/7/06	4/7/06	
TRPH mg/Kg	1,000	500	110	ND	ND	310	71	ND	56	186
Volatile Organics in soil over 1,000 ppm										
Ethylbenzene	0.41									
Xylenes	1.2									
Client ID:	S-12	S-13	S-14	S-15	S-16	S-17	S-18	S-19	S-20	
Depth	7-7.05'	8-8.5'	6.5-7'	7-7.5'	7.5-8'	4.5-5'	5-6'	7-7.5'	7.5-8'	
Date Sampled	5/15/06	5/15/06	5/15/06	5/15/06	5/15/06	5/15/06	5/15/06	5/15/06	5/15/06	
TRPH mg/Kg	1400	200	ND	ND	53	ND	ND	110	ND	160
Volatile Organics in soil over 1,000 ppm										
Ethylbenzene	0.26									
Xylenes	1.5									

Old leak contained within perched water bearing zone from 6 to 7+ feet below grade. Extensive excavation left contamination under the residence as well as extended downgradient into back yard. Normal vertical injections were used in yard and the under slab was treated with angular injection with 3 times the amount of injected material.

Analytical results three weeks later were all under NJ standard of 10,000 ppm. The average was 186 ppm for site

184 Riverview Avenue 2nd FL  
Waltham, MA 02453-3843  
Phone: 800-425-7900  
Fax: 781-644-6070  
E-mail: info@continentalremediation.com

